


Ridge Tool Company 400 Clark Street Elyria, Ohio 44036-2023, U.S.A.

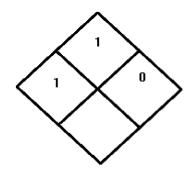

MATERIAL SAFETY DATA SHEET

SECTION 1 - PRODUCT I	NFORM	ATION					
PRODUCT NAME:			EMERGENCY TEI	EMERGENCY TELEPHONE NUMBER:			
RIDGID PREMIUM DARK THREAD CUTTING OIL			(440) 323-5581				
CHEMICAL FAMILY:			TELEPHONE NUMBER FOR INFORMATION:				
PETROLEUM HYDROCARBON			(800) 519-3456				
DOT PROPER SHIPPING NAME:			DATE PREPARED:				
NOT A REGULATED MATERIAL			MAY 2004				
SECTION II - HAZARDOU	JS INGR	EDIENTS/	IDENTITY INFO	RMATIO	N		
	C/	AS NUMBER					
HAZARDOUS COMPONENTS		io moniber	OSHA PEL	IA PEL ACGIH		0/0	
Paraffinic Mineral Oil		64742-54-7	5mg/m ³ TWA	5mg/m^3		>95%	
Z GRAMMO TIMOLO OH		o2		10mg/m3		7570	
Sulfur Additive Package		Mixture	No info	No in		<5%	
Sanai Madaive Lackage		Mixture	140 mio	140 111		S 70	
Unlisted ingredients are trade secrets:	and are not h	azardous chem	icals under OSHA Haza	erd Communic	rations		
Standard (29 CFR 1910.1200)	and are not i	azaravas enem	neam under Opini Haza	ara Communit	LaciUII0		
	/CITTON 4TA		A CERRICEICO				
SECTION III - PHYSICAL.	/CHEMIC	CAL CHAI	RACTERISTICS				
Boiling Point:		480°	Specific Gravity (H ² 0 = 1):			0.87	
Vapor Pressure (mm Hg.)		.01 @ 20°C	Solubility in Water:			NIL	
Vapor Density (Air = 1)		1	Evaporation Rate (Butyl Acetate = 1)		1		
APPEARANCE AND ODOR:			•		,	•	
Dark brown liquid							
SECTION IV - FIRE AND	EXPLOS	ION HAZ	ARD DATA				
SECTION THE ZEIG							
Flash Point: (Method Used)			Flammable Limits:	Flammable Limits:		UEL:	
385°F (Cleveland Open Cup)			Not Determined				
Extinguishing Media:							
Water Fog, Dry Chemical	, CO, or for	ım.					
Special Fire Fighting Procedures:							
Wear self contained brea		atus. Keep fi	re exposed containers	s cool with w	ater.		
Unusual Fire and Explosion Hazar							
Hot vapors form explosiv	e mixtures	with air.					
SECTION V - REACTIVIT	Y DATA						
Stability Unstable		Conditions to Avoid:					
Stable	X	Spark and Open Flames					
Incompatibility: (Materials to Avo	oid)	•					
Strong acids and oxidant	s						
Hazardous Decomposition or Byp	roducts:						
Upon Combustion - CO, 0	CO ₂ Oxides	of Sulfur					
Hazardous May Occur	ıs to Avoid:						
Polymerization Will not Occu	Polymerization Will not Occur X None						

SECTION VI - HEALTH HAZARD DATA

Route(s) of Entry: Inhalation? Skin? Ingestion? X

Health Hazards: (Acute and Chronic)

Causes Irritation - May be skin defatter upon prolonged or repeated contact. Overexposure to vapors, mist or fumes may result in upper respiratory tract irritation and difficulty breathing. Mineral oil mist, OSHA established 8 hr. TWA PEL of 5 mg/m³. ACGIH reccomends a 15 min. STEL TLV of 10 mg/m³.

IARC Monographs? OSHA Regulated? Carcinogenicity: NPT? Not Listed Not Listed Not Listed

Signs and Symptoms of Exposure:

Eyes: Mild irritation and redness. Ingestion: Gastrointestinal irritation, nausea, vomiting and diarrhea. Inhalation: Dizziness and difficulty breathing.

Medical Conditions Generally Aggravated by Exposure:

Sensitive Dry Skin.

Emergency and First Aid Procedures:

Eyes: Immediately flush with plenty of water for at least 15 minutes. Call a physician. Skin: Wash with soap and water. *Ingestion*: Do not induce vomiting. Dilute by giving at least 2 glasses of milk or water to a conscious person. Get medical attention. Inhalation: Remove to fresh air and give artificial respiration is necessary. Get medical attention

SECTION VII - PRECAUTIONS FOR SAFE HANDLING AND USE.

Steps to be Taken in Case Material is Released or Spilled:

Do not use water - Soak up with sand, earth or other inert material. Put in suitable container. Dispose of in accordance with Local, State and Federal regulations.

Waste Disposal Method:

Dispose of material in accordance with Local, State and Federal regulations. Avoid contamination of sewers and water ways.

Precautions to be Taken in Handling and Storing:

Avoid contact with eyes, skin, and clothing. Remove contaminated clothing. Launder before re-use. Wash thoroughly after handling.

Other Precautions:

Avoid breathing mist or vapors.

SECTION VIII – CONTROL MEASURES

Respiratory Protection (Specify Type):

Use NISOH approved respirator if engineering or other controls are not adequate to reduce airborne exposure to below permissible exposure limits.

Ventilation:

General dilution or local exhaust recommended.

Protective Gloves: Eye Protection:

> Neoprene Oil Impervious if subject to Safety Glasses or Goggles

continuous contact.

Other Protective Clothing or Equipment:

Aprons, Oil Repellent Barrier Creme or other as required to avoid skin contact if subject to repeated exposure.

Work/Hygienic Practices:

Wash after handling.

SECTION IX - REGULATORY INFORMATION

TSCA:

All components are registered under regulations of TSCA.

Sara Title III:

Contains no ingredients subject to reporting under Section 313. Is reportable under Sections 311 and 312 if thresholds are met. Contains no extremely hazardous substances under Section 302. Health categories are Health/Acute and Health/Chronic.

WE BELIEVE THE STATEMENTS, TECHNICAL INFORMATION AND RECOMMENDATIONS CONTAINED HEREIN ARE RELIABLE, BUT THEY ARE GIVEN WITHOUT WARRANTY OR GUARANTEE OF ANY KIND, EXPRESSED OR IMPLIED, AND WE ASSUME NO RESPONSIBILITY FOR ANY LOSS, DAMAGE, OR EXPENSE, DIRECT OR CONSEQUENTIAL, ARISING OUT OF THEIR USE.